

not kinked (kneaded or bent) or lying on their sides. You do not have to make this check for shaker-type baghouses using self-tensioning (spring-loaded) devices.

(7) Confirm the physical integrity of the baghouse through quarterly visual inspections of the baghouse interior for air leaks.

(8) Inspect fans for wear, material buildup, and corrosion through quarterly visual inspections, vibration detectors, or equivalent means.

(d) For each wet scrubber subject to the operating limits in § 63.7690(b)(2), you must at all times monitor the 3-hour average pressure drop and scrubber water flow rate using CPMS according to the requirements in § 63.7741(c).

(e) For each combustion device subject to the operating limit in § 63.7690(b)(3), you must at all times monitor the 15-minute average combustion zone temperature using a CPMS according to the requirements of § 63.7741(d).

(f) For each combustion device subject to the operating limit in § 63.7690(b)(4), you must at all times monitor the 3-hour average combustion zone temperature using CPMS according to the requirements in § 63.7741(d).

(g) For each wet acid scrubber subject to the operating limits in § 63.7690(b)(5),

(1) You must at all times monitor the 3-hour average scrubbing liquid flow rate using CPMS according to the requirements of § 63.7741(e)(1); and

(2) You must at all times monitor the 3-hour average pH of the scrubber blowdown using CPMS according to the requirements in § 63.7741(e)(2) or measure and record the pH of the scrubber blowdown once per production cycle using a pH probe and meter according to the requirements in § 63.7741(e)(3).

(h) For one or more automated conveyor and pallet cooling lines and automated shakeout lines at a new iron and steel foundry subject to the VOHAP emissions limit in § 63.7690(a)(10), you must at all times monitor the 3-hour average VOHAP concentration using a CEMS according to the requirements of § 63.7741(g).

[69 FR 21923, Apr. 22, 2004, as amended at 73 FR 7221, Feb. 7, 2008]

§ 63.7741 What are the installation, operation, and maintenance requirements for my monitors?

(a) For each capture system subject to an operating limit in § 63.7690(b)(1), you must install, operate, and maintain each CPMS according to the requirements in paragraphs (a)(1) through (3) of this section.

(1) If you use a flow measurement device to monitor an operating limit parameter for a capture system, you must meet the requirements in paragraphs (a)(1)(i) through (iv) of this section.

(i) Locate the flow sensor and other necessary equipment such as straightening vanes in a position that provides a representative flow and that reduces swirling flow or abnormal velocity distributions due to upstream and downstream disturbances.

(ii) Use a flow sensor with a minimum measurement sensitivity of 2 percent of the flow rate.

(iii) Conduct a flow sensor calibration check at least semiannually.

(iv) At least monthly, visually inspect all components, including all electrical and mechanical connections, for proper functioning.

(2) If you use a pressure measurement device to monitor the operating limit parameter for a capture system, you must meet the requirements in paragraphs (a)(2)(i) through (vi) of this section.

(i) Locate the pressure sensor(s) in or as close as possible to a position that provides a representative measurement of the pressure and that minimizes or eliminates pulsating pressure, vibration, and internal and external corrosion.

(ii) Use a gauge with a minimum measurement sensitivity of 0.5 inch of water or a transducer with a minimum measurement sensitivity of 1 percent of the pressure range.

(iii) Check the pressure tap for pluggage daily. If a “non-clogging” pressure tap is used, check for pluggage monthly.

(iv) Using a manometer or equivalent device such as a magnahelic or other pressure indicating transmitter, check gauge and transducer calibration quarterly.

(v) Conduct calibration checks any time the sensor exceeds the manufacturer's specified maximum operating pressure range, or install a new pressure sensor.

(vi) At least monthly, visually inspect all components, including all electrical and mechanical connections, for proper functioning.

(3) Record the results of each inspection, calibration, and validation check.

(b) For each negative pressure baghouse or positive pressure baghouse equipped with a stack that is applied to meet any PM or total metal HAP emissions limitation in this subpart, you must install, operate, and maintain a bag leak detection system according to the requirements in paragraphs (b)(1) through (7) of this section.

(1) The system must be certified by the manufacturer to be capable of detecting emissions of particulate matter at concentrations of 10 milligrams per actual cubic meter (0.0044 grains per actual cubic foot) or less.

(2) The bag leak detection system sensor must provide output of relative particulate matter loadings and the owner or operator shall continuously record the output from the bag leak detection system using electronic or other means (*e.g.*, using a strip chart recorder or a data logger).

(3) The system must be equipped with an alarm that will sound when an increase in relative particulate loadings is detected over the alarm set point established in the operation and maintenance plan, and the alarm must be located such that it can be heard by the appropriate plant personnel.

(4) The initial adjustment of the system must, at minimum, consist of establishing the baseline output by adjusting the sensitivity (range) and the averaging period of the device, and establishing the alarm set points and the alarm delay time (if applicable).

(5) Following the initial adjustment, do not adjust the sensitivity or range, averaging period, alarm set point, or alarm delay time without approval from the Administrator. Except, once per quarter, you may adjust the sensitivity of the bag leak detection system to account for seasonable effects including temperature and humidity according to the procedures in the oper-

ation and maintenance plan required by § 63.7710(b).

(6) For negative pressure, induced air baghouses, and positive pressure baghouses that are discharged to the atmosphere through a stack, the bag leak detector sensor must be installed downstream of the baghouse and upstream of any wet scrubber.

(7) Where multiple detectors are required, the system's instrumentation and alarm may be shared among detectors.

(c) For each wet scrubber subject to the operating limits in § 63.7690(b)(2), you must install and maintain CPMS to measure and record the pressure drop and scrubber water flow rate according to the requirements in paragraphs (c)(1) and (2) of this section.

(1) For each CPMS for pressure drop you must:

(i) Locate the pressure sensor in or as close as possible to a position that provides a representative measurement of the pressure drop and that minimizes or eliminates pulsating pressure, vibration, and internal and external corrosion.

(ii) Use a gauge with a minimum measurement sensitivity of 0.5 inch of water or a transducer with a minimum measurement sensitivity of 1 percent of the pressure range.

(iii) Check the pressure tap for pluggage daily. If a "non-clogging" pressure tap is used, check for pluggage monthly.

(iv) Using a manometer or equivalent device such as a magnahelic or other pressure indicating transmitter, check gauge and transducer calibration quarterly.

(v) Conduct calibration checks any time the sensor exceeds the manufacturer's specified maximum operating pressure range, or install a new pressure sensor.

(vi) At least monthly, visually inspect all components, including all electrical and mechanical connections, for proper functioning.

(2) For each CPMS for scrubber liquid flow rate, you must:

(i) Locate the flow sensor and other necessary equipment in a position that provides a representative flow and that

reduces swirling flow or abnormal velocity distributions due to upstream and downstream disturbances.

(ii) Use a flow sensor with a minimum measurement sensitivity of 2 percent of the flow rate.

(iii) Conduct a flow sensor calibration check at least semiannually according to the manufacturer's instructions.

(iv) At least monthly, visually inspect all components, including all electrical and mechanical connections, for proper functioning.

(d) For each combustion device subject to the operating limit in § 63.7690(b)(3) or (4), you must install and maintain a CPMS to measure and record the combustion zone temperature according to the requirements in paragraphs (d)(1) through (8) of this section.

(1) Locate the temperature sensor in a position that provides a representative temperature.

(2) For a noncryogenic temperature range, use a temperature sensor with a minimum tolerance of 2.2 °C or 0.75 percent of the temperature value, whichever is larger.

(3) For a cryogenic temperature range, use a temperature sensor with a minimum tolerance of 2.2 °C or 2 percent of the temperature value, whichever is larger.

(4) Shield the temperature sensor system from electromagnetic interference and chemical contaminants.

(5) If you use a chart recorder, it must have a sensitivity in the minor division of at least 20 °F.

(6) Perform an electronic calibration at least semiannually according to the procedures in the manufacturer's owners manual. Following the electronic calibration, conduct a temperature sensor validation check, in which a second or redundant temperature sensor placed nearby the process temperature sensor must yield a reading within 16.7 °C of the process temperature sensor's reading.

(7) Conduct calibration and validation checks any time the sensor exceeds the manufacturer's specified maximum operating temperature range, or install a new temperature sensor.

(8) At least monthly, visually inspect all components, including all electrical and mechanical connections, for proper functioning.

(e) For each wet acid scrubber subject to the operating limits in § 63.7690(b)(5), you must:

(1) Install and maintain CPMS to measure and record the scrubbing liquid flow rate according to the requirements in paragraph (c)(2) of this section; and

(2) Install and maintain CPMS to measure and record the pH of the scrubber blowdown according to the requirements in paragraph (e)(2)(i) through (iv) of this section.

(i) Locate the pH sensor in a position that provides a representative measurement of the pH and that minimizes or eliminates internal and external corrosion.

(ii) Use a gauge with a minimum measurement sensitivity of 0.1 pH or a transducer with a minimum measurement sensitivity of 5 percent of the pH range.

(iii) Check gauge calibration quarterly and transducer calibration monthly using a manual pH gauge.

(iv) At least monthly, visually inspect all components, including all electrical and mechanical connections, for proper functioning.

(3) As an alternative to the CPMS required in paragraph (e)(2) of this section, you may use a pH probe to extract a sample for analysis by a pH meter that meets the requirements in paragraphs (e)(3)(i) through (iii) of this section.

(i) The pH meter must have a range of at least 1 to 5 or more;

(ii) The pH meter must have an accuracy of ± 0.1 ; and

(iii) The pH meter must have a resolution of at least 0.1 pH.

(f) You must operate each CPMS used to meet the requirements of this subpart according to the requirements specified in paragraphs (f)(1) through (3) of this section.

(1) Each CPMS must complete a minimum of one cycle of operation for each successive 15-minute period. You must have a minimum of three of the required four data points to constitute a valid hour of data.

(2) Each CPMS must have valid hourly data for 100 percent of every averaging period.

(3) Each CPMS must determine and record the hourly average of all recorded readings and the 3-hour average of all recorded readings.

(g) For each automated conveyor and pallet cooling line and automated shakeout line at a new iron and steel foundry subject to the VOHAP emissions limit in § 63.7690(a)(10), you must install, operate, and maintain a CEMS to measure and record the concentration of VOHAP emissions according to the requirements in paragraphs (g)(1) through (3) of this section.

(1) You must install, operate, and maintain each CEMS according to Performance Specification 8 in 40 CFR part 60, appendix B.

(2) You must conduct a performance evaluation of each CEMS according to the requirements of § 63.8 and Performance Specification 8 in 40 CFR part 60, appendix B.

(3) You must operate each CEMS according to the requirements specified in paragraph (g)(3)(i) through (iv) of this section.

(i) As specified in § 63.8(c)(4)(ii), each CEMS must complete a minimum of one cycle of operation (sampling, analyzing, and data recording) for each successive 15-minute period.

(ii) You must reduce CEMS data as specified in § 63.8(g)(2).

(iii) Each CEMS must determine and record the 3-hour average emissions using all the hourly averages collected for periods during which the CEMS is not out-of-control.

(iv) Record the results of each inspection, calibration, and validation check.

[69 FR 21923, Apr. 22, 2004, as amended at 73 FR 7221, Feb. 7, 2008]

§ 63.7742 How do I monitor and collect data to demonstrate continuous compliance?

(a) Except for monitoring malfunctions, associated repairs, and required quality assurance or control activities (including as applicable, calibration checks and required zero and span adjustments), you must monitor continuously (or collect data at all required intervals) any time a source of emissions is operating.

(b) You may not use data recorded during monitoring malfunctions, associated repairs, and required quality assurance or control activities in data averages and calculations used to report emissions or operating levels or to fulfill a minimum data availability requirement, if applicable. You must use all the data collected during all other periods in assessing compliance.

(c) A monitoring malfunction is any sudden, infrequent, not reasonably preventable failure of the monitoring system to provide valid data. Monitoring failures that are caused in part by poor maintenance or careless operation are not malfunctions.

§ 63.7743 How do I demonstrate continuous compliance with the emissions limitations that apply to me?

(a) You must demonstrate continuous compliance by meeting the applicable conditions in paragraphs (a)(1) through (12) of this section. When alternative emissions limitations are provided for a given emissions source, you must comply with the alternative emissions limitation most recently selected as your compliance alternative.

(1) For each electric arc metal melting furnace, electric induction metal melting furnace, or scrap preheater at an existing iron and steel foundry,

(i) Maintaining the average PM concentration in the exhaust stream at or below 0.005 gr/dscf; or

(ii) Maintaining the average total metal HAP concentration in the exhaust stream at or below 0.0004 gr/dscf.

(2) For each cupola metal melting furnace at an existing iron and steel foundry,

(i) Maintaining the average PM concentration in the exhaust stream at or below 0.006 gr/dscf; or

(ii) Maintaining the average total metal HAP concentration in the exhaust stream at or below 0.0005 gr/dscf; or

(iii) Maintaining the average PM mass emissions rate at or below 0.10 pound of PM per ton (lb/ton) of metal charged; or

(iv) Maintaining the average total metal HAP mass emissions rate at or below 0.008 pound of total metal HAP per ton (lb/ton) of metal charged.